

retained structure is not damaged undertaking areas of demolition 6 Treat all cut, concrete faces with Ronabond concrete repair mortar by Ronacrete, or similar concrete repair

system. To be installed to manufacturer instructions.


5 Care to be taken not to cut / adversely affect existing retained beams / columns while demolition is taking place. Contractor to undertake careful exploratory works and submit appropriate method statement to ensure

7 Where trimming steels are to be installed to support existing concrete slabs, an allowance for pre-loading should be made. This should be in the form of 2 mechanical or hydraulic jacks to pre-load the beam prior to grouting, positioned at 3rd points.

The existing structural information shown on these drawings is based on visual inspection of the building, limited opening up works and relevant archive information. All details of the existing construction are subject to confirmation by the Contractor during the works on site. No materials are to be ordered until the relevant details and conditions are confirmed by the Contractor on site. Should the contractor discover any discrepancies between the assumed existing structure and what is found on site they should notify the engineer immediately, and await further instruction

Demolition legend

	Area of floor to be demolished
	Beam demolished / removed
I	Column demolished / removed
	RC / Masonry wall demolished
-X	Indicative Temporary Prop Location (Plan)
	Indicative Temporary Prop
	Area of existing rebar to be retained and re cast

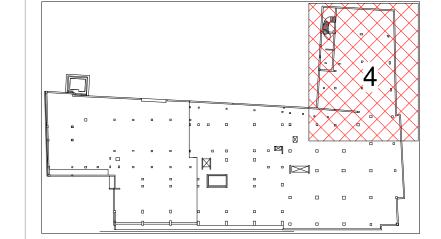

T2 11.03.20 JHL GAP Stage 4 Issue T1 23.10.19 JHL GAP Stage 3 Tender Issue Rev Date By Eng Amendments

HEYNE TILLETT

STRUCTURAL ENGINEERS

One Berkeley Street

Demolition Second Floor Part Plan Sheet 4 of 4

