




Typical In situ Manhole Detail

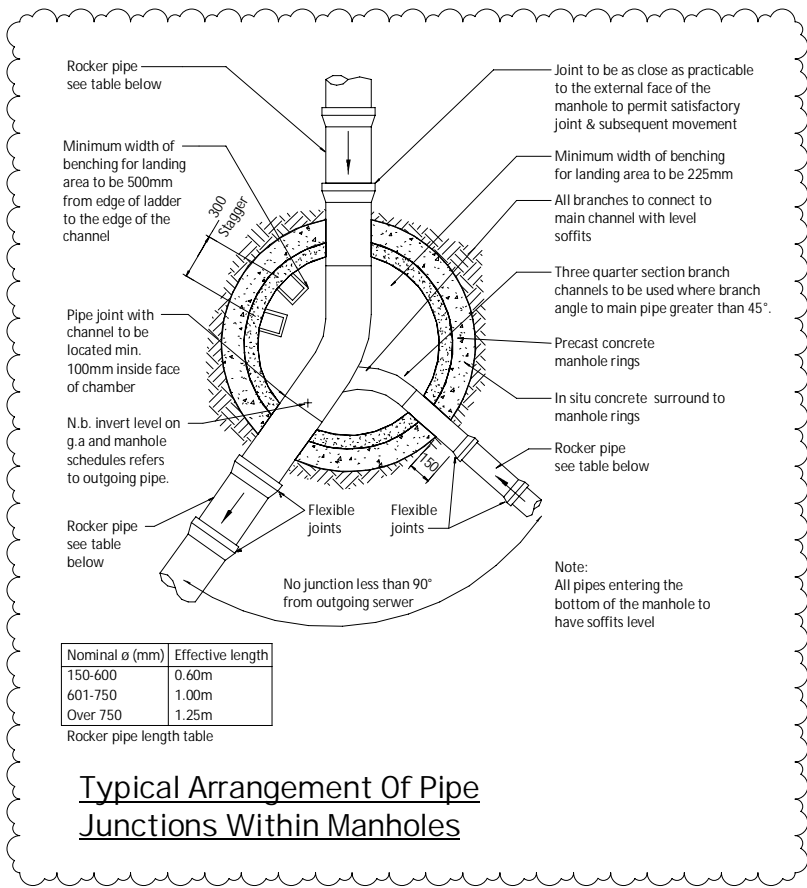


Typical Arrangement Of Pipe Junctions Within Manholes

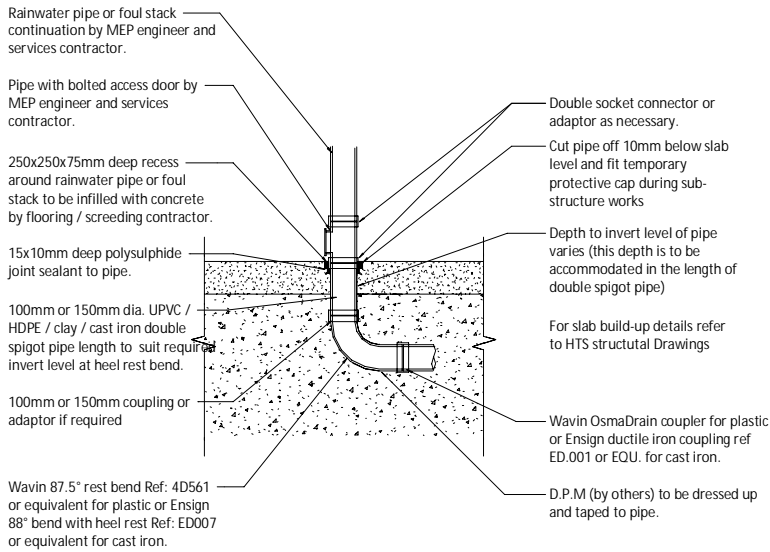


Typical Slab Penetration detail

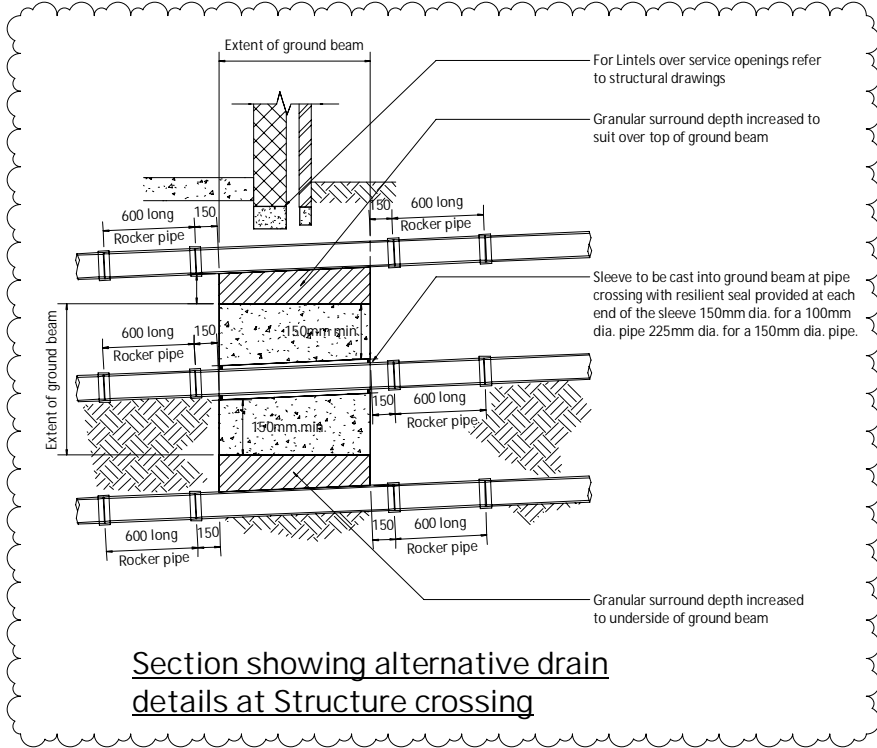

Section showing alternative drain details at Structure crossing

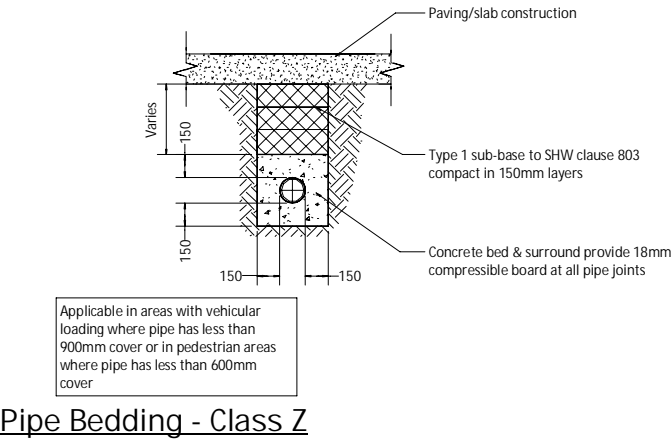

Pipe Bedding - Class Z

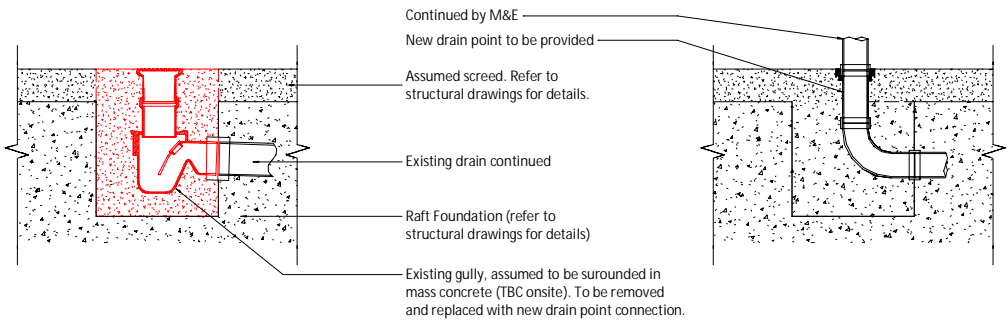

Typical Detail Showing a Floor Gully Replaced with a Drain Point

T2	02.03.20	GW	KG	Stage 4 Issue
T1	22.10.19	KG	KG	Stage 3 Tender Issue
Rev	Date	By	Eng	Amendments

HEYNE TILLET STEEL

STRUCTURAL ENGINEERS

hts.uk.com

Job Name
One Berkeley Street

Drawing Title
Typical Drainage Details